


CITY OF BALTIMORE WET WEATHER CONSENT DECREE SMOKE AND DYED WATER TESTING FORM		Page 1 of 8
Sewershed: JONES FALLS	Company: REI/DRAYCO	Date: 07/23/08
Test to be Performed: SMOKE	Ground Condition: DRY	Supervisor: ER
Manhole ID: S35MM_057MH	Test ID: 0994-365	Notifications Made: <u>X</u> (Residents, Fire, 311)
Field Sketch: (Show All Manholes with Numbers, Blower Placement Location, Sandbag or Isolation Locations, Street Names, Building Addresses and Locations, Defect Locations and Photograph Numbers)		

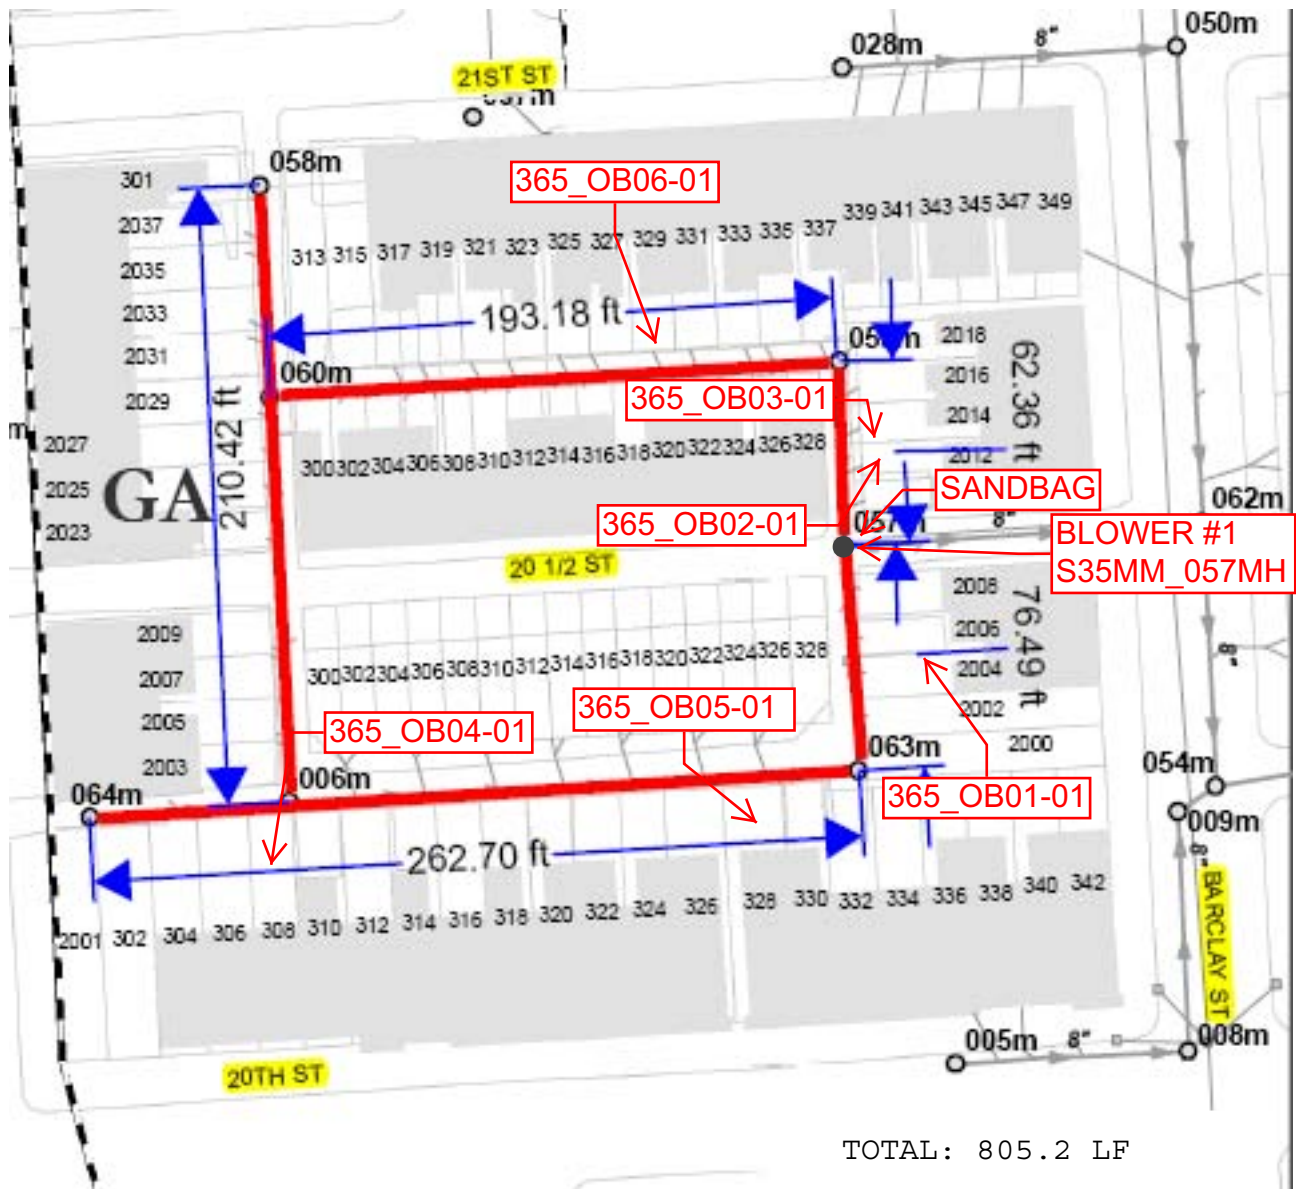

TOTAL: 805.2 LF

[illegible]

CITY OF BALTIMORE
SMOKE TESTING OBSERVATION SUMMARY
JONES FALLS SEWERSHED
BALTIMORE CITY PROJECT 994
REI/DRAYCO

Unique Test ID: 365	Date: 07/23/2008	Basin: JF-19
Defect No: OB-01	Supervisor: E.R.	Dye Test Recommended: N
Address: 2004 BARCLAY ST.		
Source Type: 02	Location: 01	Severity: 03
Sector: 02	Drainage Area: 10	
Comments: SMOKE COMING FROM BELOW CONCRETE SLAB ALONG FENCE - NOTE THAT FENCE IS NO LONGER AT LOCATION		

SMOKE TEST PHOTOGRAPHS



Photograph No: OB01-01
Filename: 0994-365_OB01-01.jpg

CITY OF BALTIMORE
SMOKE TESTING OBSERVATION SUMMARY
JONES FALLS SEWERSHED
BALTIMORE CITY PROJECT 994
REI/DRAYCO

Unique Test ID: 365	Date: 07/23/2008	Basin: JF-19
Defect No: OB-02	Supervisor: E.R.	Dye Test Recommended: N
Address: 2012 BARCLAY ST.		
Source Type: 02	Location: 01	Severity: 02
Sector: 02	Drainage Area: 6	
Comments: SMOKE COMING FROM ALONG CRACK IN SIDEWALK		

SMOKE TEST PHOTOGRAPHS



Photograph No: OB02-01
Filename: 0994-365_OB02-01.jpg

CITY OF BALTIMORE
SMOKE TESTING OBSERVATION SUMMARY
JONES FALLS SEWERSHED
BALTIMORE CITY PROJECT 994
REI/DRAYCO

Unique Test ID: 365	Date: 07/23/2008	Basin: JF-19
Defect No: OB-03	Supervisor: E.R.	Dye Test Recommended: N
Address: 2014 BARCLAY ST.		
Source Type: 03	Location: 10	Severity: 02
Sector: 02	Drainage Area: 0	
Comments: CLEAN OUT - ABOVE GRADE - NO CAP		

SMOKE TEST PHOTOGRAPHS



Photograph No: OB03-01
Filename: 0994-365_OB03-01.jpg

CITY OF BALTIMORE
SMOKE TESTING OBSERVATION SUMMARY
JONES FALLS SEWERSHED
BALTIMORE CITY PROJECT 994
REI/DRAYCO

Unique Test ID: 365	Date: 07/23/2008	Basin: JF-19
Defect No: OB-04	Supervisor: E.R.	Dye Test Recommended: N
Address: 308 20TH ST.		
Source Type: 03	Location: 08	Severity: 03
Sector: 02	Drainage Area: 3	
Comments: CLEAN OUT - BELOW GRADE - MISSING CAP		

SMOKE TEST PHOTOGRAPHS



Photograph No: OB04-01
Filename: 0994-365_OB04-01.jpg

CITY OF BALTIMORE
SMOKE TESTING OBSERVATION SUMMARY
JONES FALLS SEWERSHED
BALTIMORE CITY PROJECT 994
REI/DRAYCO

Unique Test ID: 365	Date: 07/23/2008	Basin: JF-19
Defect No: OB-05	Supervisor: E.R.	Dye Test Recommended: N
Address: 328 20TH ST.		
Source Type: 03	Location: 01	Severity: 02
Sector: 02	Drainage Area: 0	
Comments: CLEAN OUT - ABOVE GRADE - MISSING CAP		

SMOKE TEST PHOTOGRAPHS



Photograph No: OB05-01
Filename: 0994-365_OB05-01.jpg

CITY OF BALTIMORE
SMOKE TESTING OBSERVATION SUMMARY
JONES FALLS SEWERSHED
BALTIMORE CITY PROJECT 994
REI/DRAYCO

Unique Test ID: 365	Date: 07/23/2008	Basin: JF-19
Defect No: OB-06	Supervisor: E.R.	Dye Test Recommended: N
Address: 329 21ST ST.		
Source Type: 02	Location: 01	Severity: 02
Sector: 02	Drainage Area: 20	
Comments: SMOKE COMING FROM HOLE IN CONCRETE PATIO		

SMOKE TEST PHOTOGRAPHS



Photograph No: OB06-01
Filename: 0994-365_OB06-01.jpg